



# TECH TIPS

**Dixie Part Numbers:** TBA

**Applications:** 2010 Chevrolet Colorado  
2010 GMC Canyon

**Condition:** The operator of the vehicle may complain that the engine intermittently will not crank.

**Cause:** A potential cause for the above condition is an improperly crimped connection in the moulded fuse holder on the positive battery cable.

**Correction:** A voltage drop test should verify if the fuse holder is the cause of the problem, see *TSB-001 Voltage Drop Testing* for a general guide to perform this test. The manufacturer recommends replacing the fuse holder (manufacturer's number 19116350) if found to be the problem.

