



TECH TIPS

Dixie Part Numbers: TBA

Applications: 2010 Hummer H3
2010 Hummer H3T

Condition: The manufacture has identified a potential problem with the wire routing from the alternator to the battery.

Cause: The wire may chaff against the engine sight shield cover which could cause the insulation to fail over time.

Correction: Inspect the alternator positive battery cable near the rear of the alternator where it comes out from under the cover. If the cable shows signs of chaffing it must be replaced (GM part number 19116853) and rerouted following the manufacturer's recommended procedures. If the insulation is not damaged, follow the manufacturer's recommended procedures for rerouting the cable slightly by:

- loosening the cable from the alternator
- repositioning it to the 5:00 position when viewed from the pulley end of the alternator
- retightening the cable
- reinstalling the sight shield cover