



TECH TIPS

Dixie Part Numbers: TBA

Applications: 2010 – 2011 Chevrolet Equinox*
2010– 2011 GMC Terrain*
*** With Climate Control System C67 or C68**

Conditions: The operator of the vehicle may complain of one or more of the following conditions:

- Frequent low/dead battery conditions after parking for a short period of time (overnight).
- The engine fails to crank or start.

The technician will observe no diagnostic trouble codes, but when performing a parasitic (quiescent) drain test will observe a 70mA or greater draw.

Cause: A potential cause for the above conditions is a flaw in the HVAC control module that prevents the module from going into the sleep mode.

Correction: Follow the manufacturer's recommended diagnostic and repair procedures which include reprogramming the module with the updated calibration file.