



# TECH TIPS

---

**Dixie Part Numbers:** S-1529 TBA

**Applications:** 2009 – 2011 Chevrolet Aveo

**Conditions:** The operator of the vehicle may complain of an intermittent no crank/no start condition. The technician may find various diagnostic trouble codes pertaining to communications failures between the various modules.

**Cause:** A potential cause for the above condition is poor and/or deteriorated connections at the following locations:

- G103 beneath the engine control module
- G104 next to the starter motor
- X213 behind the left front kick panel
- X205 above the floor pedals
- X206 below the instrument panel, on the drivers side

**Correction:** Follow the manufacturer's recommended diagnostic and repair procedures for inspecting ground connections, terminal tension and crimping condition on the above junction points.