



# TECH TIPS

## Dixie Part Numbers:

S-1406	S-1427	S-1442	S-1460	S-1467	S-1491	S-6214	S-8212	S-8994
S-1408	S-1429	S-1444	S-1461	S-1468	S-1495	S-6236	S-8213	S-8995
S-1409	S-1430	S-1449	S-1462	S-1471	S-1498	S-6238	S-8738	S-8997
S-1422	S-1434	S-1457	S-1463	S-1476	S-1499	S-80055	S-8990	
S-1424	S-1435	S-1458	S-1465	S-1477	S-1500	S-80060	S-8991	
S-1425	S-1441	S-1459	S-1466	S-1490	S-6163	S-80098	S-8992	

## Applications:

All 2001 – 2007 Buick, Cadillac, Chevrolet, GMC, Hummer, Oldsmobile, Pontiac and Saturn Passenger Cars and Trucks with side mount battery posts.

2003 – 2007 Isuzu Ascender

2005 – 2007 Saab 9-7X

## Condition:

Some vehicles will exhibit an intermittent no crank, and/or no start conditions.

## Cause:

This condition may be due to poor battery cable connections. The poor battery cable connections could be due to cross-threaded battery cable terminals. NOTE: The battery side cable terminals are harder than the threads on the battery cable bolts, meaning that the bolts should strip first.

## Correction:

The battery side terminal posts should be inspected, and if required cleaned using the appropriate bottom tap. If the battery cable bolt was cross-threaded it should then be replaced.

Revision 20090522: Expanded bulletin from OE to cover application after 2002 and Isuzu applications  
20090917 corrected spelling  
20090923 updated wording

REV: 20090923

Courtesy of APRA

TSB\_105.doc

Dixie Tech Tips are intended for use by professional technicians, and are not for the general public. They are written to inform technicians of conditions that may exist or as a guide to aid in diagnosing and servicing a vehicle. All references to original equipment manufacturers, vehicle manufacturers and any other Trade Mark names are for the sole purpose of identifying the vehicle and or part that the Tech Tip applies to. This document is property of Dixie Electric Ltd. and is not to be copied or distributed without written permission.