



# TECH TIPS

**Dixie Part Numbers:** A-1548, A-1549 and A-1641  
S-1408, S-1460, S-1467, S-1468, S-8213 and S-8997

**Applications:** 2001 – 2002 Chevrolet Silverado Pickup with Allison® LCT1000 Automatic Transmission (RPO M74).  
2001 – 2002 GMC Sierra Pickup with Allison® LCT1000 Automatic Transmission (RPO M74)

**Condition:** The customer may complain of one or more of the following conditions:

- The transmission selector display is flashing.
- The engine will not start.
- The “Service Engine Soon” light is illuminated.
- The transmission does not shift properly.
- The vehicle will not move (the transmission will not engage).
- Diagnostic codes P0708, P0872, P0847, P0857, P1711 or P1713 may be stored in memory.

**Cause:**

Moisture may have contaminated the neutral switch causing this condition (Park Neutral Position). When turning left, water spray from the left front tire is directed onto this switch. There are front and rear shields, which are vital to a proper repair of this condition.

**Correction:**

Follow the diagnostic and repair procedures in the manufacture's service bulletin.

