



TECH TIPS

Dixie Part Numbers: A-1705 TBA

Applications: 2011 – 2012 Chevrolet Silverado 6.6L Diesel
2011 – 2012 GMC Sierra 6.6L Diesel

Conditions: The operator of the vehicle may complain of gauges fluctuating with the engine running and other electrical problems. The technician may find one or more of the following diagnostic trouble codes in the system:

P00CA	P0091	P0087	P0088	P0092
P0182	P0183	P0521	P0522	P0523
P1088	P125A	P125B	P128E	P2294
P2296				

Cause: A potential cause for the above conditions is the wiring harness chaffing on the air conditioning lines.

Correction: Follow the manufacturer's recommended diagnostic and repair procedures which include repairing any wires with chaffing damage and tie strapping them securely away from the air conditioning lines. Dixie recommends inspecting the lines and performing the "correction" before the customer complains of problems.