



TECH TIPS

Dixie Part Numbers: A-1636 and S-1449

Applications: 2002 Chevrolet Trailblazer built prior to April 2002
2002 GMC Envoy built prior to April 2002
2002 Oldsmobile Bravada built prior to April 2002

Condition:

The vehicle may exhibit one or more of the following conditions:

- no start
- service engine soon light on
- ABS warning light on
- airbag light on
- various electrical functions become inoperative

Cause:

A possible cause is moisture corroding the wiring harness in either the driver's side or passenger's side door.

Correction:

Inspect the driver door harness to determine if it has 9 or 11 wires, if it has 11 then check the passenger's side. If the either side has 9 the open wire holes/slots must be filled with RTV silicone after inspecting for corrosion in the harness. If the harness shows signs of corrosion it must be replaced following the manufacturers recommended procedures.