



TECH TIPS

Dixie Part Numbers: S-1441, S-1468 and S-1490

Applications: 2002 – 2004 Chevrolet Astro van (two-wheel drive only)
2002 – 2004 GMC Safari van (two-wheel drive only)

Condition: Some operators may have a vehicle that fails to start.

Cause: A potential cause for the above failure is a missing retaining clip on the battery cable. This missing clip allows the starter battery cable to chaff against the inner tie rod and centre drag link on right hand turns resulting in a short circuit to ground

Correction: The manufacture suggests turning left or disconnecting the battery cables (always negative first) and replacing the battery positive and negative wiring harness (part number 15085788) the new harness has additional retaining clips to prevent the wire from chaffing.