



TECH TIPS

Dixie Part Numbers: S-1422 and S-1462

Applications: 2000 – 2002 Chevrolet Venture
2000 – 2002 Oldsmobile Silhouette
2000 – 2002 Pontiac Montana
2001 – 2002 Pontiac Aztek
2002 Buick Rendezvous

Condition: Some vehicle operators may complain of hard starting, intermittent no start and/or a malfunctioning fuel gauge.

Cause: A possible cause is water contaminating the junction block (connector C305) which is located on the floor to the rear of the driver's seat. The connection is not sealed and water may corrode the terminals. Also the female connectors are prone to spreading, creating an intermittent or weak connection.

Correction: Inspect the terminals for corrosion. If corrosion is present determine the source of the water first and repair any leaks. Replace and corroded or spread terminals. The manufacture does not recommend repairing terminals that have been spread. Follow the manufacturer's recommended diagnostic and repair procedures.