



# TECH TIPS

**Dixie Part Numbers:** S-1466

**Applications:** 2006 Pontiac G6 2.4L

**Condition:** The operator of the vehicle may complain of a no start condition. The technician may find that the 30A starter fuse is blown.

**Cause:** A possible cause for this is that the purple starter wire may be chaffing against the air-conditioning line and creating an intermittent short circuit to ground.

**Correction:** Follow the manufacturers recommended procedure for repairing and/or replacing the battery cable and re-routing it behind the oil dipstick to prevent re-occurrence... Don't forget to change the fuse if it was blown.

