



# TECH TIPS

**Dixie Part Numbers:** TBA

**Applications:** 2009 – 2010 Chevrolet Traverse

**Condition:** The operator of the vehicle may complain one or more of the following conditions:

- An intermittent no crank, no start condition.
- Intermittent loss of radio.
- IPC being inoperative.

The technician may observe multiple low speed diagnostic trouble codes including but not limited to:

B0081	B0090	C0561	P0690	U0073	U0140
U0151	U0155	U0159	U0164	U0168	U0170
U0172	U0184	U0194			

**Cause:** A possible cause for the above condition is a short circuit to ground in circuit 5060.

**Correction:** Examine wiring circuit 5060 (the dark green wire) located on the front of the passenger seat frame. Check for signs of chaffing and or cutting and repair the wiring using heat-shrink tubing. Re-route the wire to prevent reoccurrence.

