



TECH TIPS

Dixie Part Numbers: TBA

Applications: 2010 – 2011 Chevrolet Camaro V8

Condition: The operator of the vehicle may complain of one or more of the following conditions:

- The engine fails to start.
- The engine fails to crank.
- The service engine soon light is on.
- The engine misfires.
- The service charging system message is displayed in the drivers information centre.
- The engine has caught on fire.

The technician may find one or more of the following diagnostic trouble codes stored in the system:

P0200	P0201	P0202	P0203	P0204	P0205
P0206	P0207	P0208	P0300	P0301	P0301
P0302	P0303	P0304	P0305	P0306	P0307
P0308	P0575	P0621	P0622	P069E	P0700
P0856	P150C	U0100	U0101	U0121	U0140

Cause: A potential cause for the above condition is the positive battery cable may come into contact with the starter housing. Over time the battery cable insulation may be damaged from chaffing and when worn through may short to ground.

Correction: The manufacturer recommends inspecting the battery cable, replacing it when required and routing it in a means that prevents chaffing.

Revisions: 20110919 Added 2011 model year and diagnostic trouble codes