



# TECH TIPS

**Dixie Part Numbers:** TBA

**Applications:** 2009 Chevrolet Malibu with 4 speed automatic transmission  
2009 Pontiac G6 with 4 speed automatic transmission  
2009 Saturn Aura with 4 speed automatic transmission

**Condition:** The operator of the vehicle may complain of one or more of the following conditions:

- The car fails to start
- The car rolls, even though in park

**Cause:** A potential cause for the above condition is faulty tabs on the transmission shift cable assembly.

**Correction:** The manufacturers' have produced a service retainer that is to be installed on the shift cable to prevent the tabs from failing. The lever may require changing as well, depending on how "aggressively" the operator would shift into park to "correct the problem". The part numbers for each kit are listed below:

Dealer retainer kit part number 19210732

Aura dealer retainer and shift lever part number 25907379

G6 dealer retainer and shift lever part number 25910201

Malibu dealer retainer and shift lever part number 25974057