



TECH TIPS

Dixie Part Numbers: TBA

Applications: 2010 Buick LaCrosse

Condition: The operator of the vehicle may complain of various electrical problems including but not limited to erratic alternator charge rates, hard or slow starting (or no starting), the service engine soon light coming on and/or running rough or misfiring.

Cause: A potential cause for the above conditions is an improperly installed engine ground strap.

Correction: Follow the manufacturer's recommended procedures for inspecting and tightening the ignition coil junction ground straps (G122 and G123) to the manufacturers recommended torque of 20 Nm (15lb-ft). Not mentioned in the OE service bulletin would be to inspect and clean the mating surfaces for rust prior to properly tightening the screws.

