



# TECH TIPS


**Dixie Part Numbers:** S-2074, S-2075, S-2076 and S-2109

**Applications:** 1998 – 2000 Ford Contour  
1999 – 2000 Mercury Mystique  
1999 – 2000 Mercury Cougar

**Condition:** The operator of the vehicle may complain of an intermittent no start condition. Inquire if this was when the wipers were left in the intermittent or low speed setting during start up.

**Cause:** The wiper motor wiring may have been routed to closely to the passive anti-theft system module.

**Correction:** Verify if the vehicle does not start with the wipers in either of the above modes. If it fails to start inspect the wire routing as shown below and if incorrectly routed tie-strap the wire further away as shown.

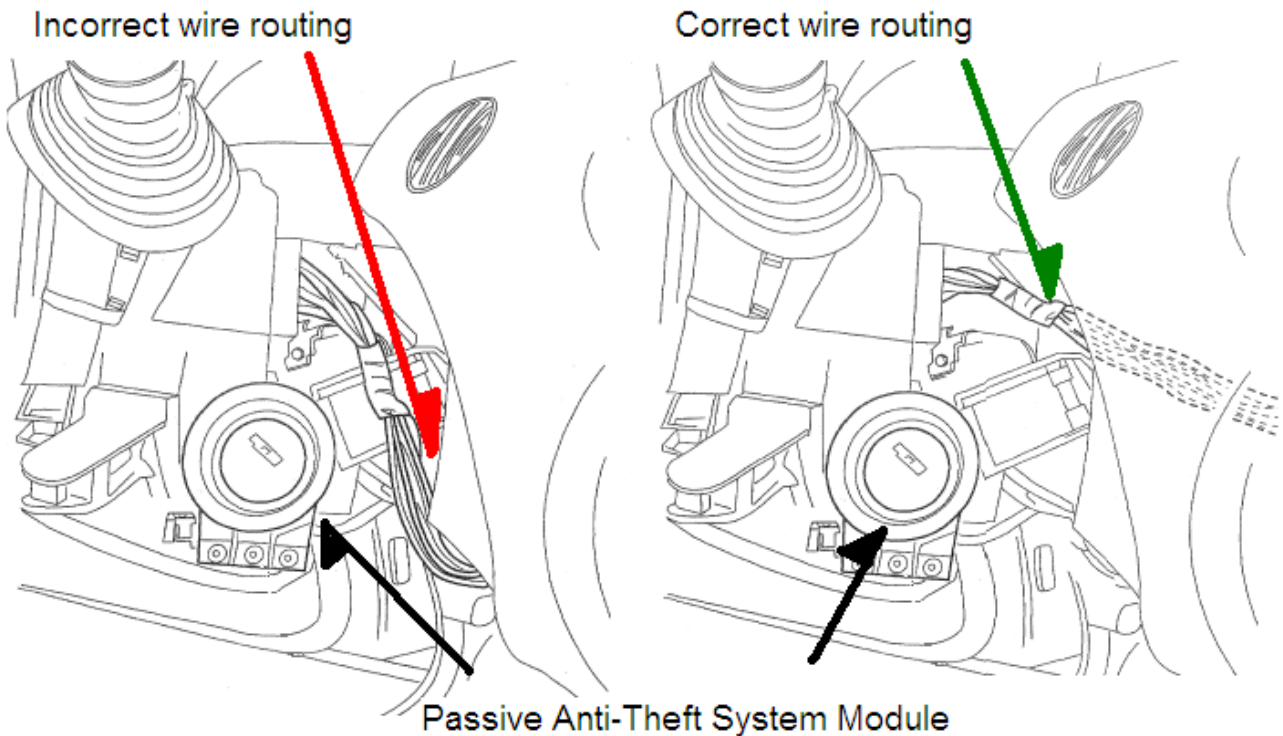

Revision: 20091023 added sketch

REV: 20091023

Courtesy of APRA

TSB\_215.doc

Dixie *Tech Tips* are intended for use by professional technicians, and are not for the general public. They are written to inform technicians of conditions that may exist or as a guide to aid in diagnosing and servicing a vehicle. All references to original equipment manufactures, vehicle manufactures and any other Trade Mark names are for the sole purpose of identifying the vehicle and or part that the *Tech Tip* applies to. This document is property of Dixie Electric Ltd. and is not to be copied or distributed without written permission.