



TECH TIPS

Dixie Part Numbers: S-2100 and S-2102

Applications: 2000 – 2001 Lincoln LS

Condition: Some vehicle operators may complain of one or more of the following conditions:

- Cranks with out starting or starter motor requires multiple replacements.
- The theft warning lamp flashes quickly
- The vehicle will start normally after turning the key off and on again.

When checking the vehicle one or more of the following conditions may be observed:

- Code U1147 and or U1262 may be stored in the instrument cluster module.
- There may be no spark and/or injector pulses.
- There is no communication with the Powertrain Control Module.

Cause: A possible cause for this is a flaw in the wiring harness causing voltage to be present at points in the system when there should be none.

Correction: The manufacturer has a jumper wiring harness that is to be installed in the lower portion of the instrument cluster (part number 1W4Z-13A612-AA). Follow the manufacturer's recommended diagnostic and repair procedures.