



TECH TIPS

Dixie Part Numbers: A-80269

Applications: 2008 – 2009 Ford Focus

Condition: The operator of the vehicle may complain that the malfunction indicator lamp comes on. The technician may observe several diagnostic codes stored in the system including P1701, P0456, P0111 and P1702.

Cause: A potential cause for the above is the calibration file.

Correction: If code P0456 is stored in the system perform an Evaporative Leak Test and repair any leaks prior to continuing. If there are no leaks update the Powertrain Control Module calibration file to 60.06 or higher. This file was not included in the 2009-3 DVD release of the updates.

