



TECH TIPS

Dixie Part Numbers: A-2113 A-80391 A-80398

Applications: 2008 – 2009 Ford F series Super Duty 6.4L Diesel

Condition: The operator of the vehicle may complain of a chirping noise coming from the serpentine belt on start up in cold soak conditions.

Cause: A potential cause for this is a faulty idler pulley located along the belt path between the water pump and the power steering pump and/or drive belt as listed below.

Correction: On Vehicles built prior to 11/9/2007 **and** equipped with the dual alternator the idler pulley located between the power steering pump and the water pump must be replaced (dealer number 7C3Z-8678-B). On 2008 and 2009 model year vehicles with a single alternator the drive belt must be replaced (dealer number AC3Z-8620-A).

