



TECH TIPS

Dixie Part Numbers: A-249 S-2057 S-2058

Applications: 1992 – 1994 Ford Explorer
 1992 – 1994 Mazda Navajo

Condition: The operator of the vehicle may complain of repeated no start conditions and a variety of other electrical problems including the loss of dash lights, head lights and/or other electrical options.

Cause: A possible cause for the above conditions is wiring in the vicinity of the battery (including the battery cables) that has corroded. The wiring and harness corrosion will be evident by discolouration, swelling and a high voltage drop.

Correction: The manufacturer recommends that all wiring with the above issues evident be replaced and that a battery cover be installed. The cover part number F3TZ-10A687-A is designed to prevent the battery emissions from corroding the wiring.

Rev: 20100409 Added Mazda applications and the alternator part number