



TECH TIPS

Dixie Part Numbers: S-2055 S-2057

Applications: 1994 Mazda B3000 with calibration files listed below:

- 4-55F-R10
- 4-55H-R10
- 4-55L-R00
- 4-55L-R10
- 4-55M-R00
- 4-55M-R10

Note: The calibration code can be found on the certification decal located on the driver's side pillar.

Condition: The operator of the vehicle may complain of one or more of the following conditions in colder temperatures (below the freezing point):

- the engine stumbles after a cold start during acceleration
- the engine stalls after the initial cold start
- an extended crank cycle or hard starting after stalling
- a no start condition after stalling

Cause: A potential cause for the above conditions is a faulty calibration file **and/or** power train control module.

Correction: Verify that there are no diagnostic trouble codes stored in the system and correct the associated problems prior performing any work on the power train control module or the calibration file. Follow the manufactures recommended procedures when changing the calibration file or the power train control module.