



# TECH TIPS

**Dixie Part Numbers:** S-6293

**Applications:** 2008 Land Rover LR2 VIN numbers 8H000212 to 8H063923

**Condition:** The operator of the vehicle may complain of one or more of the following conditions:

- Intermittently the engine fails to start and that the trip meter resets itself.
- The engine starts with difficulty and misfires or stumbles after starting. The technician may observe that diagnostic trouble codes P0087, P0089, P0171, P0174, P0628.

**Cause:** A possible cause for the above condition is the patch file in the body control module and instrument cluster control module is out of date.

**Correction:** Follow the manufacturer's recommended procedures to update the patch files to the latest ones available, which includes reconfiguring the solar sensor (IDSDVD109 Patch 4).