



# TECH TIPS

**Dixie Part Numbers:** A-6369 A-80324 A-80336

**Applications:** 2005 – 2007 Land Rover LR3  
(VIN 5A300360 – 7A449838)  
2005 – 2007 Land Rover LR3 4.0L V6  
(VIN 5A320935 – 7A4414191)  
2006 – 2007 Land Rover Range Rover  
(VIN 6A900129 – 7A257088)  
2006 – 2007 Land Rover Range Rover Sport  
(VIN 7A100001 – 7A129334)

**Condition:** The operator of the vehicle may complain of a chirp noise when starting the engine from the accessory drive belt.

**Cause:** A potential cause for the above condition is a manufacturing flaw in the idler pulley.

**Correction:** The manufacturer has released an updated idler pulley and recommends replacing the belt at the same time. The parts that may require replacing are listed below:

Application	Description	Part Number
All	Idler Pulley	PQR500350
LR3, Range Rover Sport	Belt	PQR500330
LR3 4.0L V6	Belt	PQS500081
Range Rover	Belt	PQR500320
Range Rover Sport (with Dynamic control)	Belt	PQR500340

Follow the manufacturer's recommended procedures when diagnosing and repairing the above condition.

REV: 20111129 Updated from 2010 version to include another revision to the belt on the 4.0L V6.