



# TECH TIPS

**Dixie Part Numbers:** S-1515 S-80280 TBA

**Applications:** 2007 – 2010 Saturn Outlook  
2007 – 2011 Cadillac DTS  
2007 – 2011 Cadillac STS  
2007 – 2012 GMC Acadia  
2008 – 2012 Buick Enclave  
2008 – 2012 Cadillac CTS  
2009 – 2012 Chevrolet Traverse  
2011 – 2012 Chevrolet Cruze  
2012 Buick Regal  
2012 Buick Verano  
2012 Chevrolet Sonic

**Conditions:** The operator of the vehicle may complain of one or more of the following conditions:

- The vehicle stalls intermittently.
- The vehicle fails to crank intermittently.
- The security light comes on.

The technician may observe one or more of the following diagnostic trouble codes stored in the vehicles systems B3055, B3060 and/or B3935. As all concerns are intermittent it is likely that the event can not be duplicated.

**Cause:** A potential cause for the above conditions is the vehicle's antitheft systems which require the key with the appropriate radio frequency identification to be used. Other devices such as fuel station payment pendants, employee identification cards and other transponder type devices may interfere with the vehicle's anti theft system

**Correction:** Clear the codes from the system (if present) and ensure that the operator of the vehicle understands the issues and does not keep interfering devices in close proximity to the ignition key.



# TECH TIPS

---

