



TECH TIPS

Dixie Part Numbers: A-1645 and S-1471

Applications: 2003 – 2006 Chevrolet SSR

Condition:

Vehicle operators may complain of one or more of the following conditions:

- The cargo cover won't release from the glove compartment or from the key fob.
- The vehicle won't start
- A dead battery

Cause:

A potential cause for the above issues is excessive tension on the child safety release cable. The cable activates a switch in the latch that powers up the coil side of the cargo cover release relay causing the battery to drain and the cover to no open electrically.

Correction:

Remove the cargo cover release relay and reinstall it, this should result in the cargo cover opening. If it does open then the issue is most likely being caused by the emergency release cable binding, inspect the cable paying close attention to the following areas:

- The child safety release handle may be caught or pinched behind the left cargo cover latch and the bed.
- The cable may have a bind or kink in it.
- The child safety release cable casing may not be properly seated in bracket on the latch.

If none of the above conditions are observed follow the manufacturer's recommended procedures for adjusting the cable.

REV:20090609 Updated applications to include up to 2006