



TECH TIPS

Dixie Part Numbers: S-1466

Applications: 2006 Pontiac G6 2.4L

Condition: The operator of the vehicle may complain of a no start condition. The technician may find that the 30A starter fuse is blown.

Cause: A possible cause for this is that the purple starter wire may be chaffing against the air-conditioning line and creating an intermittent short circuit to ground.

Correction: Follow the manufacturers recommended procedure for repairing and/or replacing the battery cable and re-routing it behind the oil dipstick to prevent re-occurrence... Don't forget to change the fuse if it was blown.

