



TECH TIPS

Dixie Part Numbers: S-1495

Applications: 2007 Chevrolet Cobalt
2007 Pontiac G5
2007 Saturn Ion

Condition: Some vehicle operators may complain of hard starts, no start conditions, reduced vehicle performance and intermittent lack of power. The service engine soon light may be illuminated.

The technician may note one or more of the following diagnostic trouble codes stored in the system:

- P0171
- P0300
- P1133.

Cause: A potential cause is low fuel pressure due to the collapse of the external fuel strainer on the fuel pump.

Correction: The vehicle manufacturer recommends replacing the fuel pump and filter with service kit part number 15947510. Follow the manufacturer's recommended procedures when replacing the fuel pump and filter.