



# TECH TIPS

**Dixie Part Numbers:** A-1365 A-1384

**Applications:** 1992 – 1995 Chevrolet Lumina APV Van 3.8L  
1992 – 1995 Oldsmobile Silhouette 3.8L  
1992 – 1995 Pontiac Trans Sport 3.8L

**Condition:** The operator of the vehicle may complain of one or more of the following conditions:

- intermittent electrical problems
- instrument cluster not operating properly
- erratic alternator charge rates

**Cause:** A possible cause for the above conditions is a loose ground wire at the G105 stud location.

**Correction:** Inspect the ground connection at the G105 stud. The G105 stud is located under the front coil of the distributorless ignition coil pack on the right side of the engine (left when facing the vehicle). Clean the surface and ensure the nut is torqued to the manufacturer's specifications.

