



# TECH TIPS

**Dixie Part Numbers:** TBA

**Applications:** 2010 Cadillac SRX  
2010 Chevrolet Camaro

**Condition:** The operator of the vehicle may complain of one or more of the following conditions:

- Water accumulating on the passenger's side floorboard
- The MIL light intermittently coming on
- Cranking without starting

The technician may observe diagnostic trouble codes P025A, P069E or P0267 stored in the system.

**Cause:** A potential cause is poor sealing along the seams on the cowling area, or on the wiring grommet where it passes through the firewall.

**Correction:** The manufacturer recommends resealing the seam just under the windshield where the 2 pieces of sheet metal meet by:

- removing the air inlet grill,
- cleaning the area thoroughly
- applying Kent High Tech Seam Sealer (dealer number 10200) or the equivalent
- reinstalling the grill

It is further recommended to perform the following:

- inspecting and sealing the grommet if required
- inspecting junction X210 located in the passengers side foot well, ensuring it is clean and dry and applying dielectric grease to the terminals
- ensure that the carpeting and area is completely dried (if wet)