



TECH TIPS

Dixie Part Numbers: A-1636 A-1645 A-1705 A-1757
 A-1761 A-1762 S-1449 S-1468
 S-1506 S-1511 S-1524 TBA

Applications: 2002 – 2009 Chevrolet Trailblazer
 2002 – 2009 GMC Envoy
 2002 – 2004 Oldsmobile Bravada

Condition: The operator of the vehicle may complain of a low or dead battery, long or hard starting or a failure to crank. The technician may observe a high quiescent draw (parasitic drain) of 4 to 5A (4000 – 5000 mA).

Cause: The above condition may be caused by a bent or damaged rear wiper arm or blade. The rear wiper motor may be attempting to park the rear wiper.

Correction: Follow the manufacturer's recommended diagnostic and repair procedures when applicable.

