



TECH TIPS

Dixie Part Numbers: NA at the time of release

Applications: 2009 Lincoln MKS with the THX audio system
2009 Lincoln MKZ with the THX audio system
2009 Lincoln Navigator with the THX audio system

Condition: The operator of the vehicle may complain that there is a screeching, popping, feedback. In addition they may comment that the THX setting switches back to the default stereo mode after starting or that the volume setting has increased with a cycle of the start key.

Cause: A possible cause is that the THX audio module may have an older calibration file.

Correction: The correct calibration file for the THX audio module is 59.7 patch 10 or 60.1 patch 1 and higher. These files were not included on the 2009.3 DVD release of updates.

