



TECH TIPS

Dixie Part Numbers: A-2078 A-2113 A-80391 A-80398

Applications: 2008 Ford F-53 Motorhome Chassis 5.4L and 6.8L
2008 - 2009 Ford F Super Duty 5.4L and 6.8L

Condition: The operator of the vehicle may complain that the malfunction indicator lamp comes on. In addition they may comment on rough idling and intermittent transmission issues (delayed engagement, loss of power, loss of engagement).

Cause: A possible cause for the above is an out of date calibration file.

Correction: Reprogram the Powertrain Control Module to release 59.12 and higher or 60.05 and higher. These calibration files were not included in the 2009-3 DVD release. Follow the manufacturer's recommended procedures to update the calibration files.

