



TECH TIPS

Dixie Part Numbers: S-2059 S-2060 S-2066
 S-2077 S-2079

Applications: 1992 – 1995 Ford Taurus
 1992 – 1995 Ford Thunderbird
 1992 – 1995 Lincoln Continental
 1992 – 1995 Mercury Cougar
 1992 – 1995 Mercury Sable
 1995 Ford Windstar

Condition: The operator of the vehicle may complain of an intermittent no start/no crank condition up to and including complete failure of the vehicle to start.

Cause: A potential cause for the above condition is a severely corroded lead at the starter solenoid connection.

Correction: The manufacturer recommends replacing the wiring harness with a new version part number F4VY-14A411-A, which alleviates this condition. Do not sand or file the starter terminal as this creates grooves which will trap moisture. Brush dielectric grease, such as D7AZ-19A331-A, or the equivalent, on the terminals when installing the starter.