



TECH TIPS

Dixie Part Numbers: A-249

Applications: 1991 – 1994 Mazda Navajo

Condition: The operator of the vehicle may complain of a squealing noise during starting of a cold engine in a cold climate with temperatures below -18°C (0°F).

Cause: A potential cause for the above condition is the idler pulley bearing grease, which from the factory was manufactured with a grease not specified to operate in extreme cold conditions.

Correction: Follow the manufacturer's recommended procedure to ensure that the idler pulley is the source of the noise, and if required, replace the pulley with manufacturer's part number ZZM5-15-970 which replaces ZZL0-15-940A.

