



# TECH TIPS

**Dixie Part Numbers:** S-2055 S-2057 S-2058 S-2061

**Applications:** 1995 – 1996 Mazda B Series Pickup (built between 11/01/94 and 03/30/96)

**Condition:** The operator of the vehicle may complain of an extended crank cycle after a hot soak (driving for more than 30 minutes so that the engine is completely heated up). The technician may find the starter has failed due to continued cranking.

**Cause:** A potential cause for the above condition may be the idle air control valve not opening at high temperatures.

**Correction:** Verify that there are no diagnostic trouble codes stored in the system prior to replacing any parts. Correct any codes prior to changing the idle air control valve. Follow the manufacturer's recommended procedure for replacing the valve (if required) take note that there were issues with the part and the updated part numbers are listed below.

Part Number		Model
New Part Number	Original Part Number	
ZZM7-20-660	ZZM9-20-660	B2300
ZZMB-20-660	ZZM4-20-660	B3000