



TECH TIPS

Dixie Part Numbers: A-248 A-274 A-275 A-283
A-296 A-2024 A-2025 A-2031
S-2095 S-8423

Applications: 1999 Ford F 350 Supercab

Condition: The operator of the vehicle may complain of intermittent electrical problems up to and including complete electrical system failure.

Cause: A potential cause for the above is the battery cable wiring. The positive and negative battery cables have a clip attached to them and are taped together. The clip attaches the cables to the frame rail. If incorrectly positioned the positive battery cable can contact the compressor pulley for the air conditioner.

Correction: Inspect the battery cable and re-route it if required following the manufacturer's recommended procedures.

