



TECH TIPS

Dixie Part Numbers: TBA

Applications: 2009 Mazda Tribute

Condition: The operator of the vehicle may complain that when the engine is shut off and then restarted after a short period, such as when refuelling, that there is a clicking sound coming from under the hood and the engine cranks slowly and/or runs rough once started. The technician may find diagnostic trouble codes P017X, P0316, P044X, P045X, P144A and/or P1450 retained in the system memory.

Cause: A possible cause for the above condition a faulty evaporative emission canister purge valve.

Correction: Follow the manufacturers recommended diagnostic and repair procedures which include replacing the evaporative emission canister purge valve (manufacturers number ZZC4-18-741A).

