



# TECH TIPS

**Dixie Part Numbers:** TBA

**Applications:** 2010 Volvo S80 Type 124 chassis range 0113101-0116162  
2010 Volvo V70 Type 135 chassis range 0118101-0128300  
2010 Volvo XC70 Type 136 chassis range 0074101-0076536

**Condition:** The operator of the vehicle may complain that the vehicle will not accept one or both of the keys and that the engine will not crank.

**Cause:** A potential cause for the above condition is... the chrome plating on the trim on the bezel of the start control unit... the plating material from the factory was metallic and in some cases prevented the start control unit from receiving the signal from the key.

**Correction:** Follow the manufacturer's diagnostic and repair procedures when applicable. The manufacture has released an updated bezel that does not have the metallic materials in the coating, manufacturer's part number 9123403. The start control unit itself does not require replacing.

