



TECH TIPS

Dixie Part Numbers: TBA

Applications: 2008 – 2011 BMW X5 xDrive35d (M57Y engine)

Condition: The operator of the vehicle may complain that there is a loss of power steering, various warnings may come on and the battery dies.

Cause: A potential cause for the above condition is a faulty belt tensioner bracket.

Correction: Inspect the B-pillar label for code number 594 if code 594 has been punched out then the bracket has already been replaced as a service campaign. If code 594 has not been punched out follow the manufacturer's recommended procedures to replace the belt tensioner and bracket assembly (manufacturer's number 11 28 7 799 851).

