



TECH TIPS

Dixie Part Numbers:	S-7030	S-7031	S-7046	S-80135
	S-80136	S-80220	S-80248	TS-1500
	TS-1501	TS-1512	TS-1611	TS-1652
	TS-1668	TS-1677	TS-1678	TS-1785
	TS-1794	TS-1796	TS-1806	TS-1810
	TS-1811	TS-1812	TS-1824	TS-1873
	201-39121	201-41101	201-42101	201-42102
	201-42114	201-42120		

Applications: 2002 – 2007 International 9000 Series – Equipped with a Caterpillar C10, C11, C12, C13, C15 or C16 Engine

Condition: The operator of the vehicle may comment on one of the following conditions:

- the engine fails to start
- the vehicle wiring has burnt
- the vehicle caught on fire

The technician may observe that the positive battery cable has chaffed against the ground cable between the starter and the engine and/or is the origin of the fire.

Cause: When assembled the above applications were manufactured with the above flaw in the design. The dealer network was to recall and correct this situation.

Correction: When servicing on the above applications ensure that the vehicle has the wires routed separately. International had revised the wiring and routing to prevent chaffing and shorting against each other. On applications that have been updated there will be brackets supporting the cables.

Revision 20111019: Corrected engine C15 was mistyped as C5
20191024 Updated Dixie part numbers