



TECH TIPS

Dixie Part Numbers: S-8236 S-8237 S-8355 S-8361

Applications: 1989 – 1998 Mazda MPV

Condition: The operator of the vehicle may complain of a no start condition. If the engine does start, it may idle rough and lack engine power when driving. Typically this will be observed after the timing belt has been changed.

Cause: A potential cause for the above condition is a worn timing belt tensioner pulley.

Correction: Verify the problem and when replacing the timing belt the pulley, belt and **pulley spacer** must be changed as a set. The manufacturer's part numbers are listed below. Follow the manufacturer's recommended procedures when installing the timing belt and required parts.

Description	Part Number
Timing Belt	JF01-12-205D
Spacer	JF01-12-754
Tensioner Pulley	JE15-12-750A