



TECH TIPS

Dixie Part Numbers: A-80197 S-80280
Not all applications currently assigned a Dixie part number

Applications: 2008 – 2009 Cadillac CTS and CTS-V with the the EZ-key option

Condition: The operator of the vehicle may complain of one or more of the following conditions:

- A long/slow cranking period
- A dead battery
- Premature alternator failure

The technician will observe a quiescent draw of 4 amps when inspecting the vehicle.

Cause: A potential cause for the above condition is a software conflict in the memory seat module and the key fob which leaves the vehicle's internal network (GMLAN) to stay active. Three conditions have been identified as to when the problem occurs:

- The vehicle has the EZ-key option, and
- The memory seat/easy exit recall is set to the "on" or automatic on" mode.
- A driver key fob with an ID number greater then 2 is used.

Correction: The manufacturer has released a calibration file to address this condition. Follow the manufacturer's recommended procedures for trouble shooting and updating the calibration file when appropriate.

REV:20101220 Superceded S-80369 to S-80280