



TECH TIPS

Dixie Part Numbers: S-8775 S-8985

Applications: 1999 – 2000 Mitsubishi Galant

Condition: The operator of the vehicle may complain that the vehicle fails to crank or start. The technician may observe that the starter fuse is blown. Repairing the fuse may temporarily correct the problem but not necessarily.

Cause: A potential cause for the above is that the main power lead may be heat damaged and due to the proximity to the exhaust manifold heat shield and the lead may short to ground through the heat shield.

Correction: The manufacturer has recommended the removal of the heat shield and if required replacing and rerouting of the positive starter lead to prevent shorting to ground.

