



TECH TIPS

Dixie Part Numbers: S-80027 S-80356 S-80359 TBA

Applications: 2007 – 2010 Nissan Alitma Sedan (CVT Only)
2008 – 2010 Nissan Alitma Coupe (CVT Only)
2007 – 2010 Nissan Alitma Hybrid (L32HV Only)
Excluding HEV Consult-III

Condition: The operator of the vehicle may complain that the engine fails to crank or start (or go to the ready mode on Hybrid applications) when pressing the pushbutton switch and applying the brakes. The accessories and ignition can be turned on and off as normal.

Cause: A potential cause for the above condition is a brake lamp switch and sub-harness flaw.

Correction: Follow the manufacturer's recommended diagnostic and repair procedures when applicable which include installing the following parts:

Harness Subassembly	24167-ZX00J	1 piece
Stop Lamp Switch Assembly	25320-JN00A	1 piece
Tie Strap	24216-W1000	4 pieces