



TECH TIPS

Dixie Part Numbers: NA

Applications: 2011 Kawasaki Ninja ZX10R*
2011 Kawasaki Ninja ZX10R ABS*
*Note Restricted to models ZX1000JBF,
ZX1000JBFL, ZX1000KBF, and ZX1000KBFL



Condition: The operator of the vehicle may complain that the engine stalls intermittently or has stalled and fails to restart.

Cause: A potential cause for the above conditions is a short circuit in the wiring harness. The wiring harness may chaff and short to ground in the following locations:

- In the rear sub-frame at the rear fender.
- In the rear sub-frame at the seat mounting bolt.

Correction: Follow the manufacturers recommended diagnostic and repair procedures and replace worn parts and reroute the wiring harness to avoid future chafing issues.

