



TECH TIPS

Dixie Part Numbers: S-80280 TBA

Applications: 2008 – 2011 Buick Enclave
2009 – 2011 Chevrolet Traverse
2007 – 2011 GMC Acadia
2007 – 2010 Saturn Outlook

Conditions: The operator of the vehicle may complain of one or more of the following conditions:

- Intermittently the engine does not crank or start
- The lift gate is inoperative.
- Various warning lights coming on intermittently.

The Technician may observe one or more of the diagnostic trouble codes stored in the system memory:

U0073	U0140	U0151	U0155	U0159	U0164
U0168	U0170	U0184	U0194	U0198	U0214
U0249					

Cause: A potential cause for the above conditions is a damaged communications cable.

Correction: There have been 2 locations where the communications cable may be damaged from chaffing:

- On the left side of the vehicle at the left B pillar at the rear of the front door opening
- The other location is on the left side at the B pillar but at the front of the rear door. Follow the manufacturers recommended diagnostic and repair procedures, which include replacing the faulty valve.

Follow the manufacturer's recommended diagnostic and repair procedures.