



# TECH TIPS

**Dixie Part Numbers:** A-8911 A-80287 A-80299 A-80344  
A-80389 S-8772 S-80383 S-80408 TBA

**Applications:** 2004 – Present Scion All Models with Electronic Throttle

**Conditions:** The technician may observe an extremely low idle or rough idle after servicing the vehicle.

**Cause:** If the 12 volt power is disconnected when performing any service (such as working on the alternator or starter) the engine control module/powertrain control module will loose the “self learnt” adjustments made to compensate for deposits in the electronic throttle control.

**Correction:** When doing any repairs where the power is disconnected follow the manufacturer’s recommended electronic throttle cleaning procedures. Note the warning not to spray cleaner directly in as this will damage the throttle motor and position sensor.