



TECH TIPS

Dixie Part Numbers: S-80464 TBA

Applications: 2009 – 2011 Toyota Corolla automatic transmission
2009 – 2011 Toyota Matrix automatic transmission

Conditions: The operator of the vehicle may complain that the malfunction indicator light is on, that the engine fails to crank or start, or that the transmission functions erratically. The technician may observe diagnostic trouble code P0717 stored in the system.

Cause: A potential cause for the above conditions is rodent damage to the wiring insulation near the speed sensor connector.

Correction: Follow the manufacturer's recommended diagnostic and repair procedures which include replacing the wiring harness with a new one (manufacturer's number 82126-02050).

