



TECH TIPS

Dixie Part Numbers: S-80280 TBA

Applications: 2010 – 2012 Chevrolet Camaro

Conditions: The operator of the vehicle may complain that intermittently the vehicle does not crank or start. Additionally there may be fluctuating gauges on the dash, the service engine soon light may come on or various other electrical problems.

Cause: A potential cause for the above is a short circuit in the high speed local area network wiring.

Correction: Follow the manufacturer's diagnostic and repair procedures which include inspecting the wiring directly below the engine control module for chaffing on the inner fender panel. Repair and reroute wiring to prevent further damage when applicable.