



# TECH TIPS

**Dixie Part Numbers:** A-80036

**Applications:** 2003 – 2005 Toyota 4Runner (V6) with VIN information earlier then identified below.

Originating Plant	Drive Train	VIN Where corrected
Tahara	2-wheel drive	JTEZU1#R_50055199
	4-wheel drive	JTEBU1#R_50066323
Hino	2-wheel drive	JTEZU1#R_58031852
	4-wheel drive	JTEBU1#R_58041908

**Condition:** Customers may complain that the charge warning light on the dash may come on during winter months.

**Cause:** A potential cause for the charge warning indicator light coming on is salt water residue getting inside the alternator in climates where salt is used on the road to melt the snow.

**Correction:** Toyota recommends using A-80305 in place of A-80036 with the installation of a foam strip in the engine cover and an engine oil baffle plate. Refer to the manufactures recommended installation procedures when installing these parts.

Rev: 20100304 Superseded A-80305 to A-80036